



**Monthly Performance Report
August 2011**

Reference	:	ESSP-DRD-4898
Edition Number	:	01-00
Edition Date	:	27.09.2011
Status	:	Released Issue
Intended for	:	General Public



European Satellite Services Provider SAS

18 Avenue Edouard Belin, BPI 602 31401 Toulouse Cedex 9

Société par action simplifiée

R.C.S. Toulouse 508 275 286

SIRET 508 275 286 00013

DISCLAIMER

All data and information (hereinafter the "Data") provided within this document are for informational purposes only. This document does not provide the ESSP interpretation of the Data.

The European Union, as owner of EGNOS, and ESSP SAS, as EGNOS services provider, disclaim all warranties of any kind (whether express or implied) to any party and/or for any use of the Data including, but not limited to, their accuracy, integrity, reliability and fitness for a particular purpose or user requirements.

By using the Data, the user agrees that the European Union and ESSP SAS shall not be held liable for any direct or indirect or consequential loss or damage (such as loss of profits, business, contracts, anticipated savings, goodwill or revenue) resulting from the use, misuse or inability to use the Data.

Text and pictures that are part of the Data may be protected by property rights. Any use shall require the prior written agreement of ESSP SAS.



TABLE OF CONTENTS

1	EGNOS SiS Availability.....	5
2	Open Service (OS).....	6
2.1	Receiver Monitoring network	6
2.2	EGNOS Horizontal and Vertical Accuracy	7
2.3	EGNOS Open Service Availability	9
3	Safety-of-Life Service (SoL)	10
3.1	EGNOS Non Precision Approach (NPA)	10
3.1.1	EGNOS NPA availability	10
3.1.2	EGNOS NPA Continuity	11
3.1.3	EGNOS NPA Integrity Events.....	12
3.1.4	EGNOS NPA Accuracy	13
3.2	EGNOS Approach with Vertical guidance (APV-I)	14
3.2.1	EGNOS APV-I Availability	14
3.2.2	EGNOS APV-I Continuity Risk	15
3.2.3	EGNOS APV-I Integrity	16
3.2.4	EGNOS APV-I Accuracy	17
4	EGNOS Data Access Service (EDAS).....	18
Appendix A	Reference DOcuments	20
Appendix B	List of acronyms	21



LIST OF FIGURES

Figure 1 – EGNOS SIS & PRN Availability for August 2011(%).....	5
Figure 2 – Trending of EGNOS SIS Availability per GEO.....	5
Figure 3 – Receiver monitoring network	6
Figure 4 – EGNOS APV-I Horizontal Navigation System Error: PRN 120 (left) and PRN124 (right) ..	8
Figure 5 – EGNOS APV-I Vertical Navigation System Error: PRN 120 (left) and PRN124 (right).....	8
Figure 6 – EGNOS Open Service Availability at reference stations (PRN120).....	9
Figure 7 - EGNOS Open Service Availability at reference stations (PRN124)	9
Figure 8 - EGNOS NPA Availability	10
Figure 9 - EGNOS NPA Continuity	11
Figure 10 – EGNOS NPA Horizontal Safety Index of the month: PRN 120 (left) and PRN124 (right)	12
Figure 11 – EGNOS APV-I Availability	14
Figure 12 – EGNOS APV-I Continuity	15
Figure 13 – EGNOS APV-I Horizontal Safety Index of the month: PRN 120 (left) and PRN124 (right)	16
Figure 14 – EGNOS APV-I Vertical Safety Index of the month: PRN 120 (left) and PRN124 (right)	16

LIST OF TABLES

Table 1 – EGNOS SIS Availability (%) on EGNOS GEO satellites.....	5
Table 2 - List of sites where performances are reported.....	6
Table 3 - Trending of the maximum daily (at 95% measured) accuracy values per month	7
Table 4 – Average of EGNOS NPA Accuracy on PRN 120 and 124 at reference stations	13
Table 5 – Average of EGNOS APV-I Accuracy on PRN 120 and 124 at reference stations.....	17
Table 6 – EDAS Availability	18

1 EGNOS SIS AVAILABILITY

*In this document, **EGNOS SIS Availability** is defined as the percentage of time in the month during which at least one geostationary satellite broadcasts EGNOS messages.*

In addition to the SIS availability for PRN120 and PRN124, the following values are also reported:

- percentage of time in the month during which at least one geostationary satellite broadcasts EGNOS messages (PRN120 or PRN124);
- percentage of time in the month during which both geostationary satellites broadcast EGNOS messages (PRN120 and PRN124).

EGNOS SIS monitoring during August 2011, reports the following reception percentage of an SBAS message:

- PRN120 Availability: **99.99%**
- PRN124 Availability: **99.73%**
- SIS - PRN120 or PRN 124: **100.00%**
- PRN120 and PRN124: **99.72%**

The following figure presents the availability of the signal in both EGNOS GEO satellites (PRN120 and PRN124). Red dots correspond to unavailability periods:

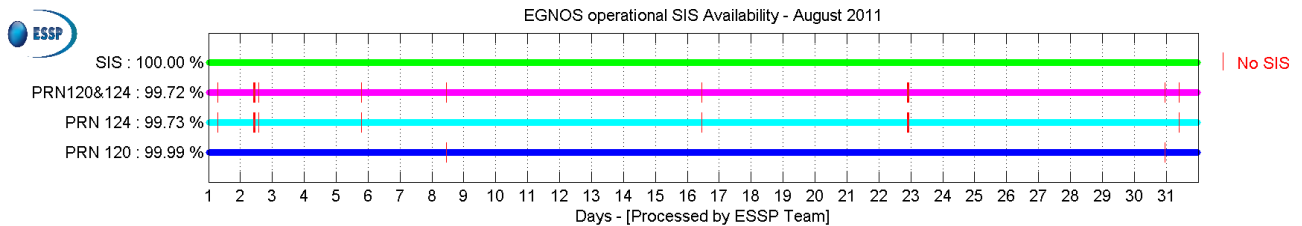


Figure 1 – EGNOS SIS & PRN Availability for August 2011(%)

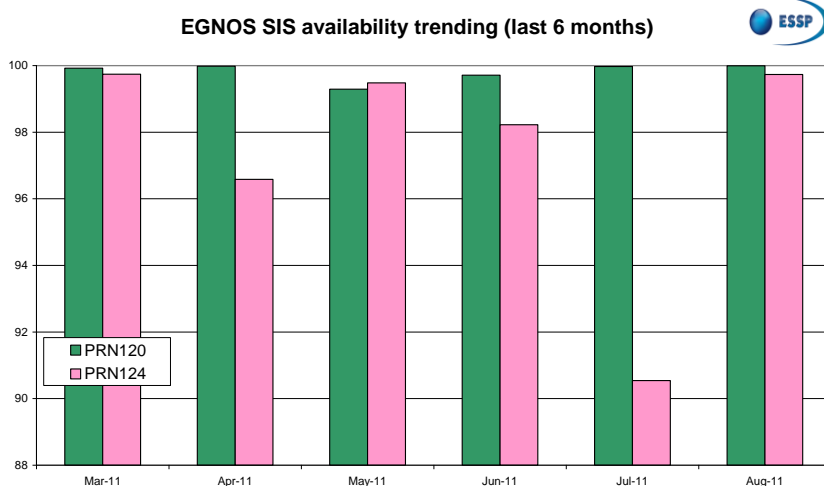


Figure 2 – Trending of EGNOS SIS Availability per GEO

Availability (%)	03/11	04/11	05/11	06/11	07/11	08/11
PRN120	99.92	99.98	99.29	99.71	99.97	99.99
PRN124	99.74	96.58	99.48	98.22	90.54	99.73
SIS At least one EGNOS GEO satellite	100	100	100	100	100	100

Table 1 – EGNOS SIS Availability (%) on EGNOS GEO satellites

2 OPEN SERVICE (OS)

2.1 Receiver Monitoring network

The receiver network used to report EGNOS performances in this document is mainly composed of EGNOS monitoring stations (RIMS), except in the case of the receiver located at Torrejón.

Next map shows the location of sites reported:

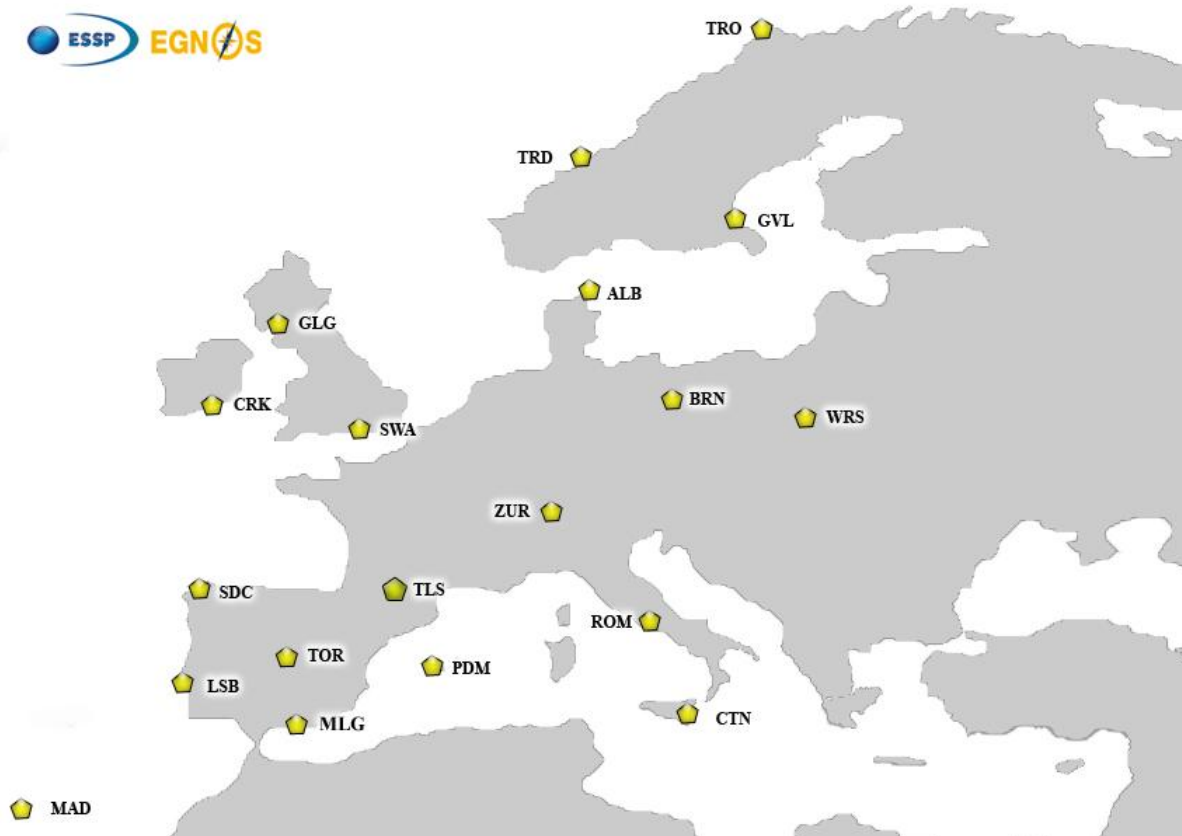


Figure 3 – Receiver monitoring network

ID	Location name	Country	ID	Location name	Country
ALB	Alborg	Denmark	PDM	Palma de Mallorca	Spain
BRN	Berlin	Germany	ROM	Rome	Italy
CTN	Catania	Italy	SDC	S. de Compostela	Spain
CRK	Cork	Ireland	GVL	Gävle	Sweden
WRS	Warsaw	Poland	TLS	Toulouse	France
GLG	Glasgow	United Kingdom	TRD	Trondheim	Norway
LSB	Lisbon	Portugal	TRO	Tromsøe	Norway
SWA	Swanwick	United Kingdom	ZUR	Zürich	Switzerland
MAD	Madeira	Portugal	TOR	Torrejón- SBAS receiver	Spain
MLG	Málaga	Spain			

Table 2 - List of sites where performances are reported.



2.2 EGNOS Horizontal and Vertical Accuracy

Accuracy is a measure of the position error, which is the difference between the estimated navigation position and the actual position.

EGNOS OS Horizontal Accuracy is reported in this document as the 95th percentile of the Horizontal Navigation System Error (HNSE) over a day, at the monitored sites when applying EGNOS messages. The HNSE is measured only when there is a valid PA navigation solution.

EGNOS OS Vertical Accuracy is reported in this document as the 95th percentile the Vertical Navigation System Error (VNSE) over a day, at the monitored sites when applying EGNOS messages. The VNSE is measured only when there is a valid PA navigation solution.

Table 3 provides the maximum of the values of accuracy at 95% measured on a daily basis during the last six months. The unit of these figures is meters.

Accuracy [m] PRN 120		03/11	04/11	05/11	06/11	07/11	08/11	Average
MLG	HPE	1.89	1.28	1.17	1.21	1.22	1.27	1.34
	VPE	2.16	1.59	1.64	1.57	1.71	1.61	1.71
SDC	HPE	1.13	1.24	1.20	1.27	1.16	1.26	1.21
	VPE	1.35	1.52	1.56	1.38	1.47	1.61	1.48
PDM	HPE	0.80	1.18	1.02	1.05	1.04	1.20	1.05
	VPE	1.21	1.43	1.32	1.40	1.37	1.65	1.40
LSB	HPE	1.29	1.32	1.21	1.26	1.37	1.32	1.30
	VPE	2.10	2.20	2.13	2.45	2.29	2.35	2.25
TRD	HPE	1.26	1.71	0.89	0.86	0.76	0.93	1.07
	VPE	2.25	2.38	1.89	1.66	1.69	2.25	2.02
CRK	HPE	1.03	1.00	1.07	0.89	1.24	1.14	1.06
	VPE	1.70	1.69	1.38	1.30	1.61	1.62	1.55
ZUR	HPE	0.93	0.98	1.01	0.97	1.01	1.07	1.00
	VPE	1.23	1.33	1.33	1.31	1.18	1.03	1.24
BRN	HPE	1.03	0.93	0.97	0.82	0.84	0.99	0.93
	VPE	1.53	1.62	1.36	1.41	1.34	1.45	1.45
TLS	HPE	0.90	0.92	1.09	1.06	1.01	1.11	1.02
	VPE	1.17	1.22	1.58	1.25	1.22	1.09	1.26
TRO	HPE	1.67	1.66	1.41	1.37	1.28	1.24	1.44
	VPE	3.24	2.97	3.14	3.02	2.62	2.49	2.91
SWA	HPE	1.27	1.40	1.46	1.23	1.31	1.44	1.35
	VPE	1.81	1.90	1.80	1.77	1.59	1.67	1.76
ROM	HPE	0.85	0.93	1.02	0.87	1.07	1.13	0.98
	VPE	1.37	1.55	1.35	1.21	1.53	1.52	1.42
ALB	HPE	0.77	0.96	0.76	0.72	0.65	0.74	0.77
	VPE	1.72	1.75	1.59	1.42	1.71	1.45	1.61
GLG	HPE	1.14	0.95	0.82	0.88	1.64	0.87	1.05
	VPE	1.95	1.81	1.40	1.29	1.58	1.51	1.59
GVL	HPE	1.05	1.10	0.73	0.77	0.69	0.81	0.86
	VPE	2.15	2.59	1.94	1.63	1.76	1.76	1.97
WRS	HPE	1.19	1.09	1.07	1.09	0.95	1.22	1.10
	VPE	1.65	2.07	1.86	1.64	1.37	1.63	1.70
CTN	HPE	1.07	1.22	1.15	1.17	1.24	1.49	1.22
	VPE	1.78	2.02	1.93	2.09	2.23	2.18	2.04
MAD	HPE	1.99	1.90	1.50	1.63	1.87	1.80	1.78
	VPE	2.47	2.71	2.32	3.11	2.54	2.50	2.61
TOR	HPE	0.97	1.01	1.15	1.10	1.00	1.09	1.05
	VPE	1.27	1.24	1.35	1.28	1.30	1.35	1.30

Accuracy [m] PRN 124		03/11	04/11	05/11	06/11	07/11	08/11	Average
MLG	HPE	1.89	1.28	1.16	1.21	1.53	1.29	1.39
	VPE	2.11	1.59	1.65	1.60	1.68	1.61	1.71
SDC	HPE	1.13	1.24	1.20	1.25	1.39	1.24	1.24
	VPE	1.35	1.58	1.52	1.37	1.45	1.52	1.47
PDM	HPE	0.81	1.15	1.02	1.05	1.43	1.24	1.12
	VPE	1.20	1.42	1.32	1.39	1.41	1.65	1.40
LSB	HPE	1.29	1.32	1.21	1.31	1.69	1.31	1.36
	VPE	2.11	2.21	2.18	2.20	2.28	2.38	2.23
TRD	HPE	1.30	1.66	0.88	0.86	0.71	0.88	1.05
	VPE	2.24	2.39	1.89	1.69	1.68	2.24	2.02
CRK	HPE	1.03	1.00	1.06	0.93	1.26	1.14	1.07
	VPE	1.71	1.67	1.38	1.29	1.60	1.63	1.55
ZUR	HPE	0.94	0.99	1.01	0.98	1.21	1.07	1.03
	VPE	1.24	1.32	1.34	1.30	1.17	1.05	1.24
BRN	HPE	1.04	0.93	0.98	0.83	0.93	1.01	0.95
	VPE	1.53	1.62	1.34	1.42	1.33	1.44	1.45
TLS	HPE	0.92	0.91	1.09	1.04	1.14	1.09	1.03
	VPE	1.17	1.21	1.58	1.24	1.21	1.11	1.25
TRO	HPE	1.64	1.69	1.43	1.37	1.35	1.26	1.46
	VPE	3.24	3.00	3.11	2.98	2.72	2.55	2.93
SWA	HPE	1.27	1.37	1.44	1.46	1.40	1.44	1.40
	VPE	1.80	1.90	1.80	1.78	1.56	1.68	1.75
ROM	HPE	0.85	0.92	1.02	0.86	1.41	1.17	1.04
	VPE	1.37	1.55	1.35	1.27	1.54	1.53	1.44
ALB	HPE	0.78	0.98	0.73	0.71	0.65	0.74	0.77
	VPE	1.71	1.75	1.57	1.41	1.69	1.49	1.60
GLG	HPE	1.14	0.94	0.83	0.88	1.65	0.86	1.05
	VPE	1.97	1.81	1.39	1.29	1.54	1.50	1.58
GVL	HPE	1.04	1.11	0.75	0.77	0.70	0.81	0.86
	VPE	2.14	2.56	1.90	1.62	1.73	1.77	1.95
WRS	HPE	1.20	1.07	1.08	1.07	1.22	1.22	1.14
	VPE	1.65	2.01	1.77	1.65	1.40	1.64	1.69
CTN	HPE	1.16	1.23	1.14	1.19	1.40	1.47	1.27
	VPE	1.77	2.04	1.94	2.07	2.28	2.24	2.06
MAD	HPE	2.07	1.87	1.49	1.64	1.93	1.81	1.80
	VPE	2.50	2.67	2.46	3.13	2.12	2.45	2.56
TOR	HPE	0.96	1.01	1.14	1.09	1.20	1.08	1.08
	VPE	1.27	1.24	1.30	1.27	1.31	1.33	1.29

Table 3 - Trending of the maximum daily (at 95% measured) accuracy values per month

Next figures provide the HNSE and VNSE histograms over the month.

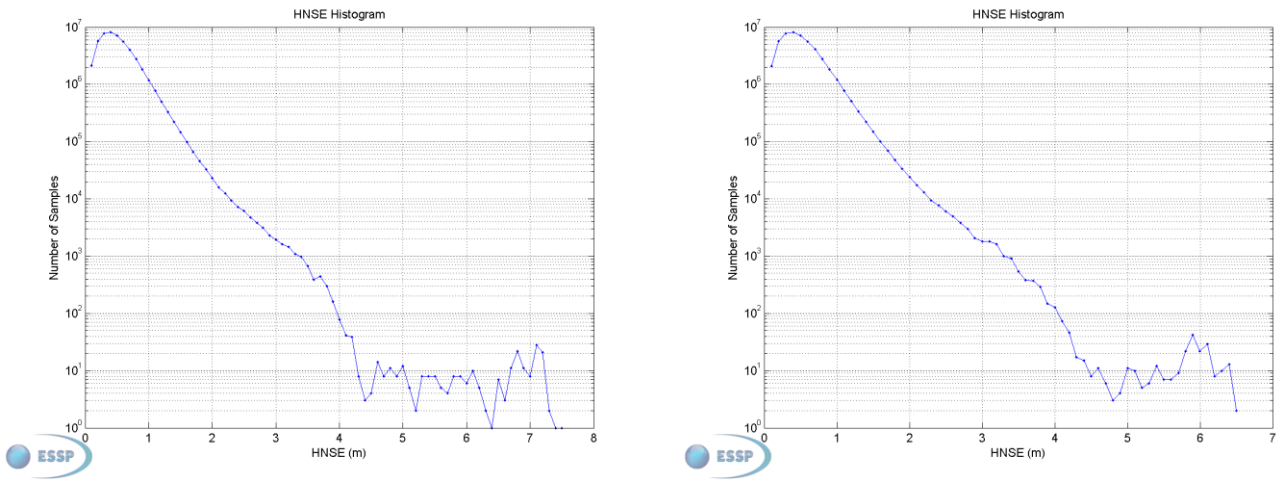


Figure 4 – EGNOS APV-I Horizontal Navigation System Error: PRN 120 (left) and PRN124 (right)

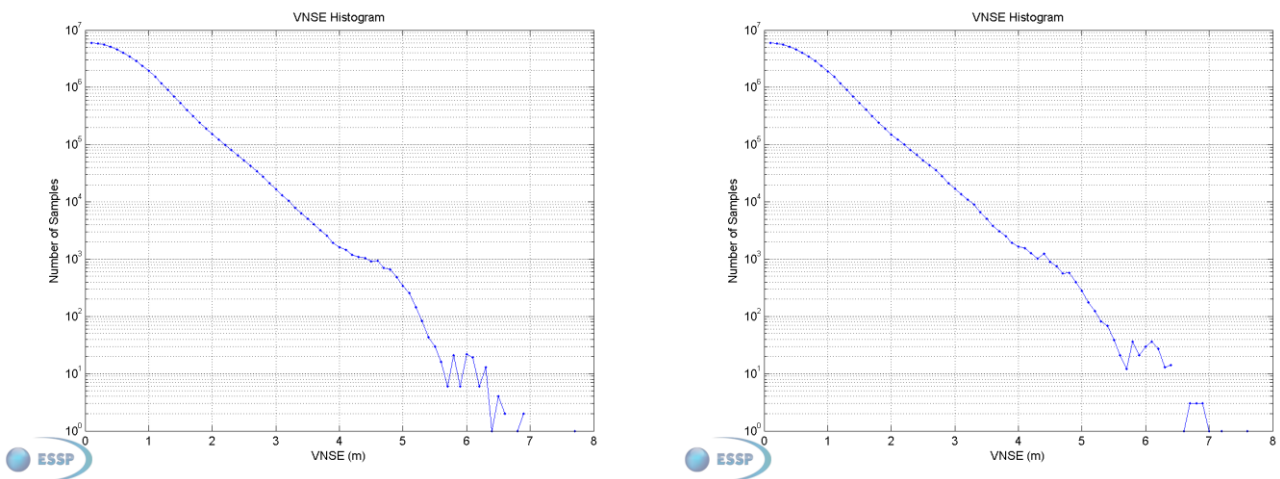


Figure 5 – EGNOS APV-I Vertical Navigation System Error: PRN 120 (left) and PRN124 (right)

2.3 EGNOS Open Service Availability

EGNOS OS Availability performance is defined in the present document as the percentage of time when the instantaneous HNSE is lower than 3 meters and the instantaneous VNSE is lower than 4 meter over the total number of samples with valid PA navigation solution

The following figures present, for each of the EGNOS GEO satellite, the Open Service availability measured in the monitoring stations for the reported month. The orange region represents the commitment as published in the Open Service Definition Document ([RD 1]).

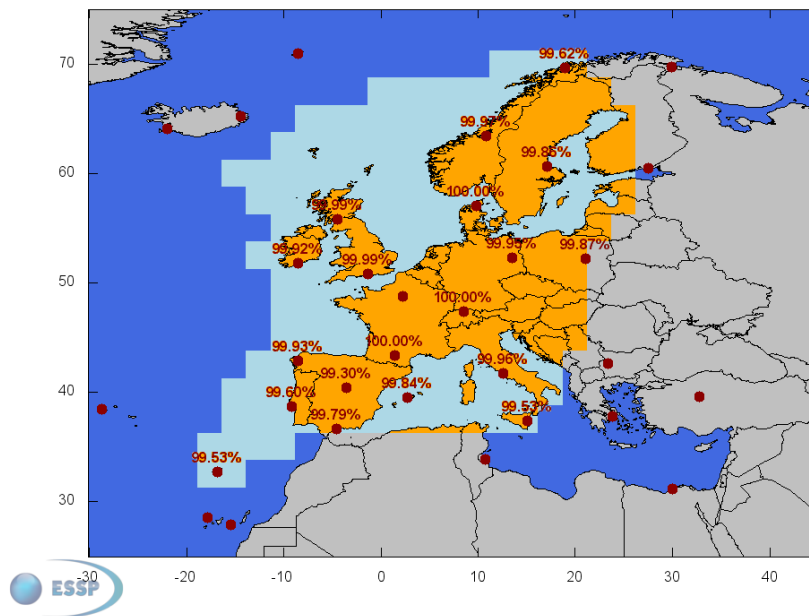


Figure 6 – EGNOS Open Service Availability at reference stations (PRN120)

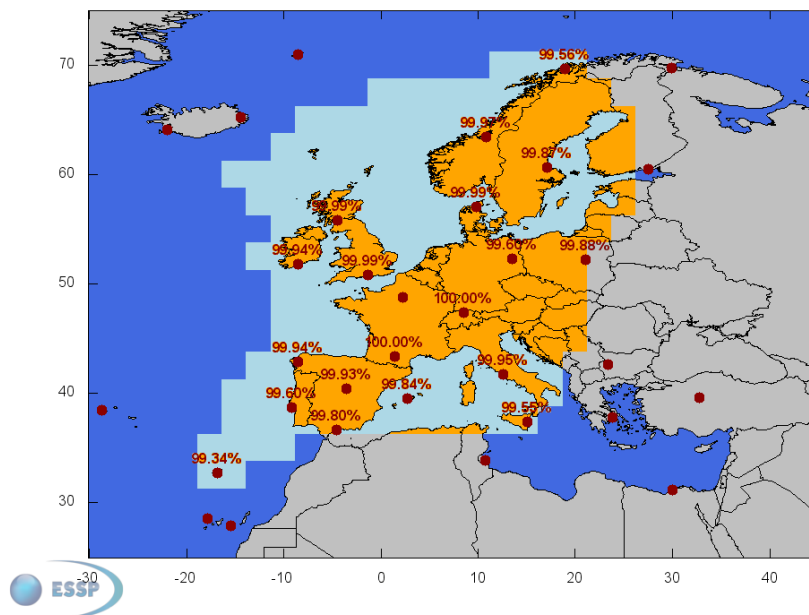


Figure 7 - EGNOS Open Service Availability at reference stations (PRN124)

3 SAFETY-OF-LIFE SERVICE (SOL)

3.1 EGNOS Non Precision Approach (NPA)

3.1.1 EGNOS NPA availability

In this report, EGNOS NPA Availability is defined as the percentage of samples in which the Horizontal Protection Level is below Alert Limit for NPA (HPL<556m) over the total period.

The following figure presents EGNOS NPA Availability over the current month using GEO-combined maps for the PRN120 and PRN124. NPA Availability considering RAIM is not taken into account in this report.

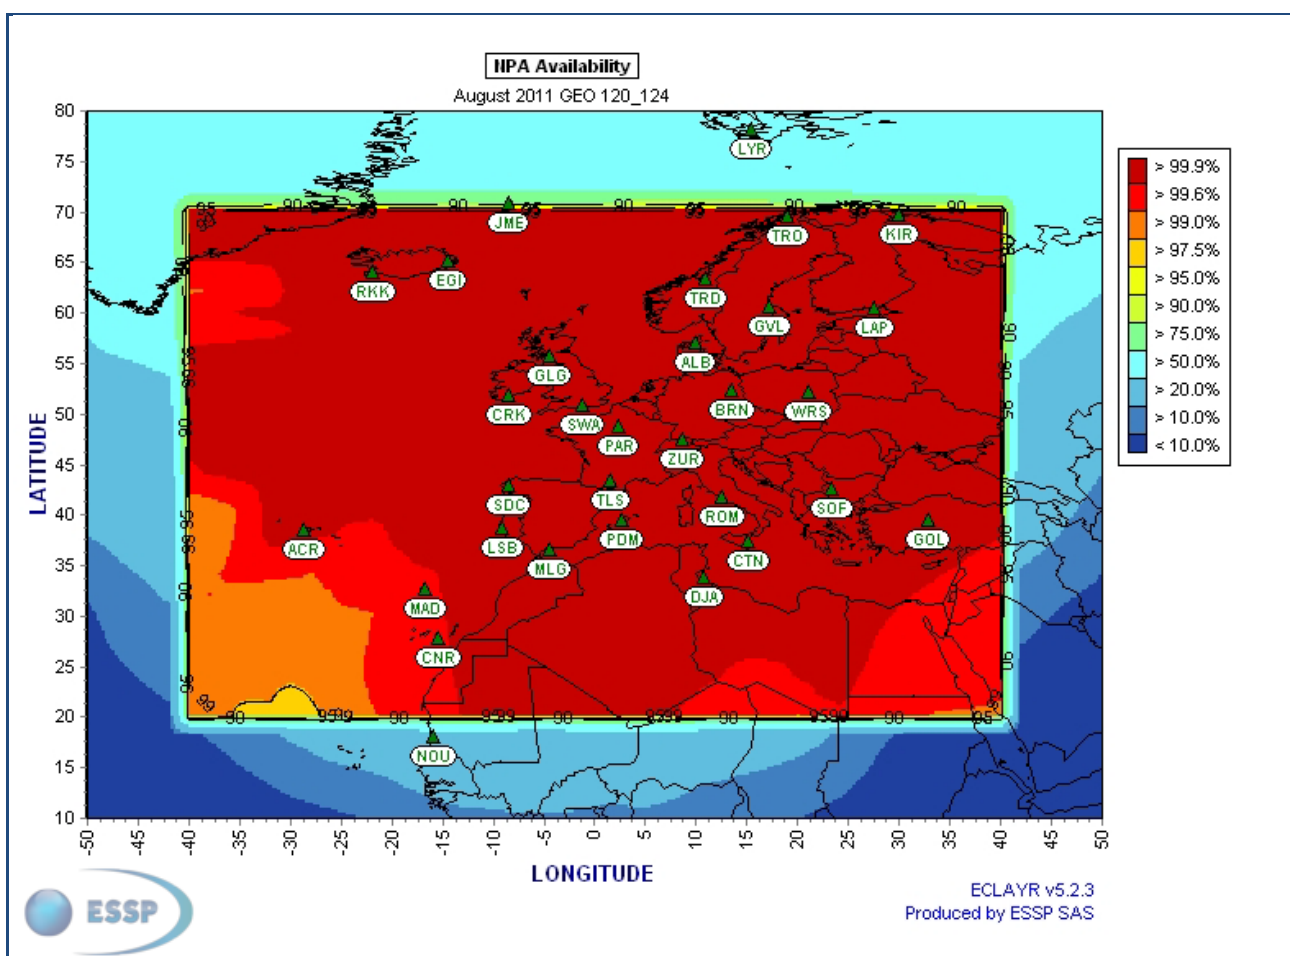


Figure 8 - EGNOS NPA Availability

3.1.2 EGNOS NPA Continuity

*In this document, **EGNOS NPA Continuity** is reported as the result of dividing the total number of single continuity breaks using a time-sliding window of 1 hour by the number samples with valid and available NPA navigation solution. A single continuity break occurs if the system is available and, at least one second inside the following time-sliding window of 1 hour becomes not available.*

The following picture presents EGNOS NPA Continuity using GEO-combined maps for the PRN120 and PRN124. NPA Continuity considering RAIM is not taken into account in this report. The degradation observed this month is mainly related to the degradation of the GPS constellation, for which several NANUs were issued.

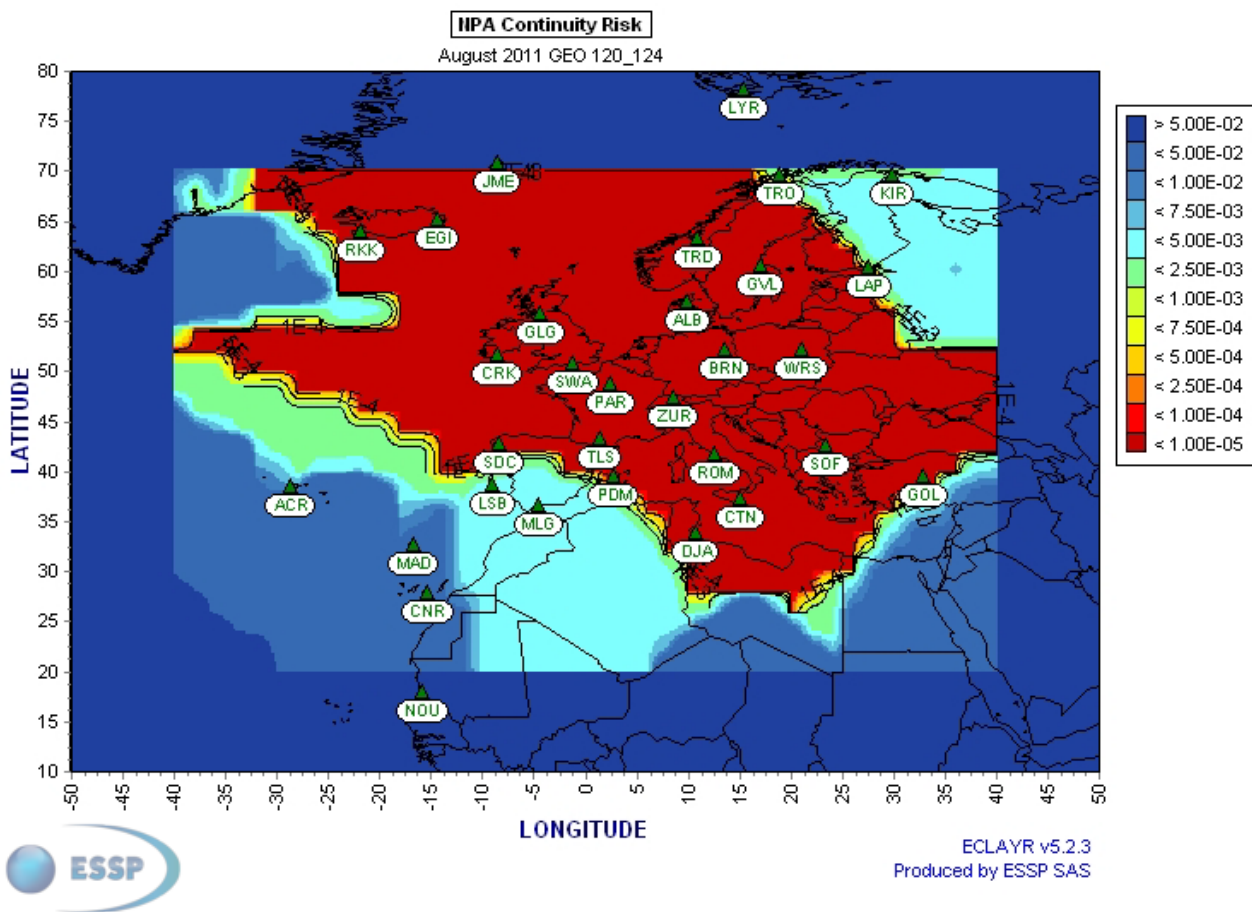


Figure 9 - EGNOS NPA Continuity

3.1.3 EGNOS NPA Integrity Events

EGNOS NPA Integrity Event is identified in the present report when the Navigation System Error is greater or equal to the corresponding Protection Level for NPA.

No integrity event was detected.

EGNOS NPA Integrity is defined as the maximum value of the Safety Index over the month. Safety index is defined as the relation between Navigation System Error versus Protection Level (assuming NPA algorithms to compute $xNSE$ and xPL). Case of ratio $xNSE/xPL$ is over 1, it indicates that a Misleading Information situation has occurred.

Next figures provide the histogram for HSI (Horizontal Safety Index) when accumulating measurements from RIMS A sites for the current month. These histograms consider that the Protection Level is below the NPA service Alarm Limit.

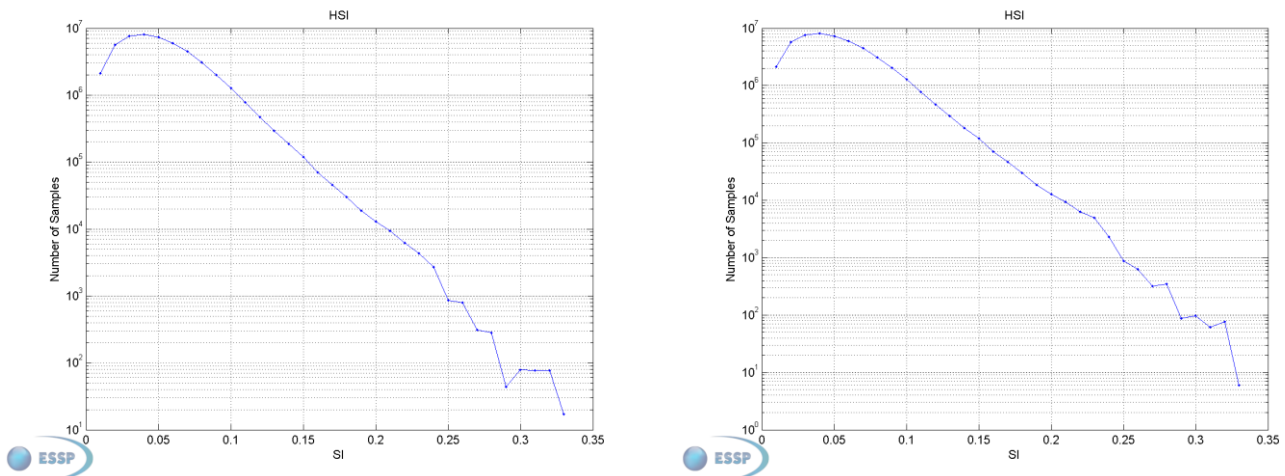


Figure 10 – EGNOS NPA Horizontal Safety Index of the month: PRN 120 (left) and PRN124 (right)



3.1.4 EGNOS NPA Accuracy

In this document, EGNOS NPA Accuracy is reported as the monthly average value of 95th percentile of the Horizontal Navigation System Error (HNSE) over a day, at the monitored sites when applying EGNOS messages. The HNSE is measured only when there is a valid NPA navigation solution.

Following table shows the monthly average of EGNOS NPA Accuracy values in meters according to the previous definition per operational GEO satellite.

Accuracy [m] (95%)	PRN 120	PRN 124
Both GEOs		
MLG	1.29	1.28
SDC	1.03	1.04
PDM	0.86	0.86
LSB	1.06	1.06
TRD	0.68	0.68
CRK	0.88	0.89
ZUR	0.93	0.93
BRN	0.82	0.82
TLS	0.90	0.90
TRO	1.02	1.04
LAP	0.82	0.82
SWA	1.20	1.21
ROM	0.92	0.92
ALB	0.61	0.61
GLG	0.72	0.72
KIR	0.92	0.92
GVL	0.62	0.62
WRS	0.87	0.88
CTN	1.39	1.38
MAD	1.28	1.27
TOR	0.89	0.88

Table 4 – Average of EGNOS NPA Accuracy on PRN 120 and 124 at reference stations

3.2 EGNOS Approach with Vertical guidance (APV-I)

3.2.1 EGNOS APV-I Availability

EGNOS APV-I Availability is defined here as the percentage of epochs in a month in which the Protection Level are below Alert Limits for this APV-I service (HPL<40m and VPL<50m) over the total period.

The following picture presents the EGNOS APV-I Availability over the current month using GEO-combined maps for PRN120 and PRN124.

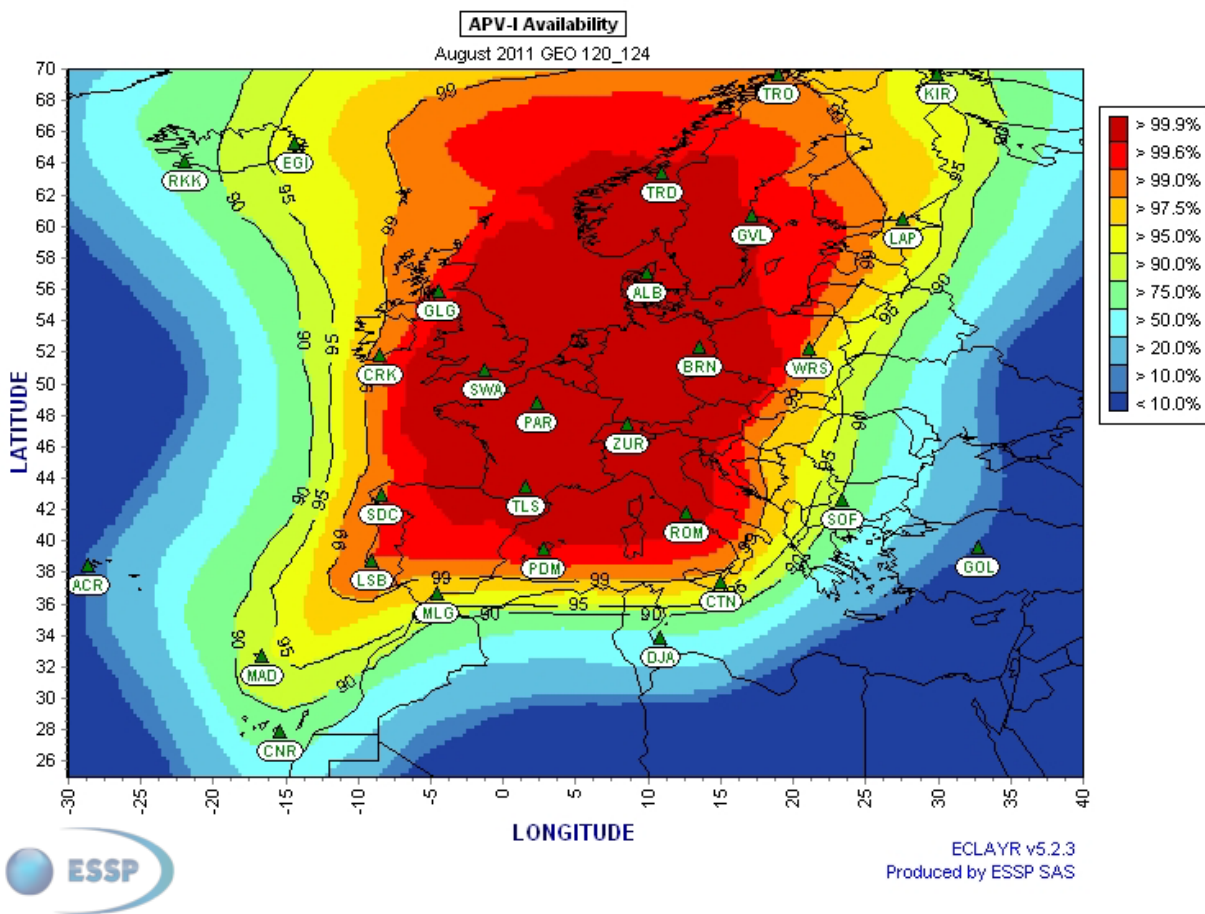


Figure 11 – EGNOS APV-I Availability

3.2.2 EGNOS APV-I Continuity Risk

EGNOS APV-I Continuity is defined here as the result of dividing the total number of single continuity breaks using a time-sliding window of 15 seconds by the number samples with valid and available PA navigation solution. A single continuity break occurs if the system is available and, at least one second of inside the following time-sliding window of 15 seconds becomes not available.

The following picture presents the EGNOS APV-I Continuity over the current month using GEO-combined maps for PRN120 and PRN124.

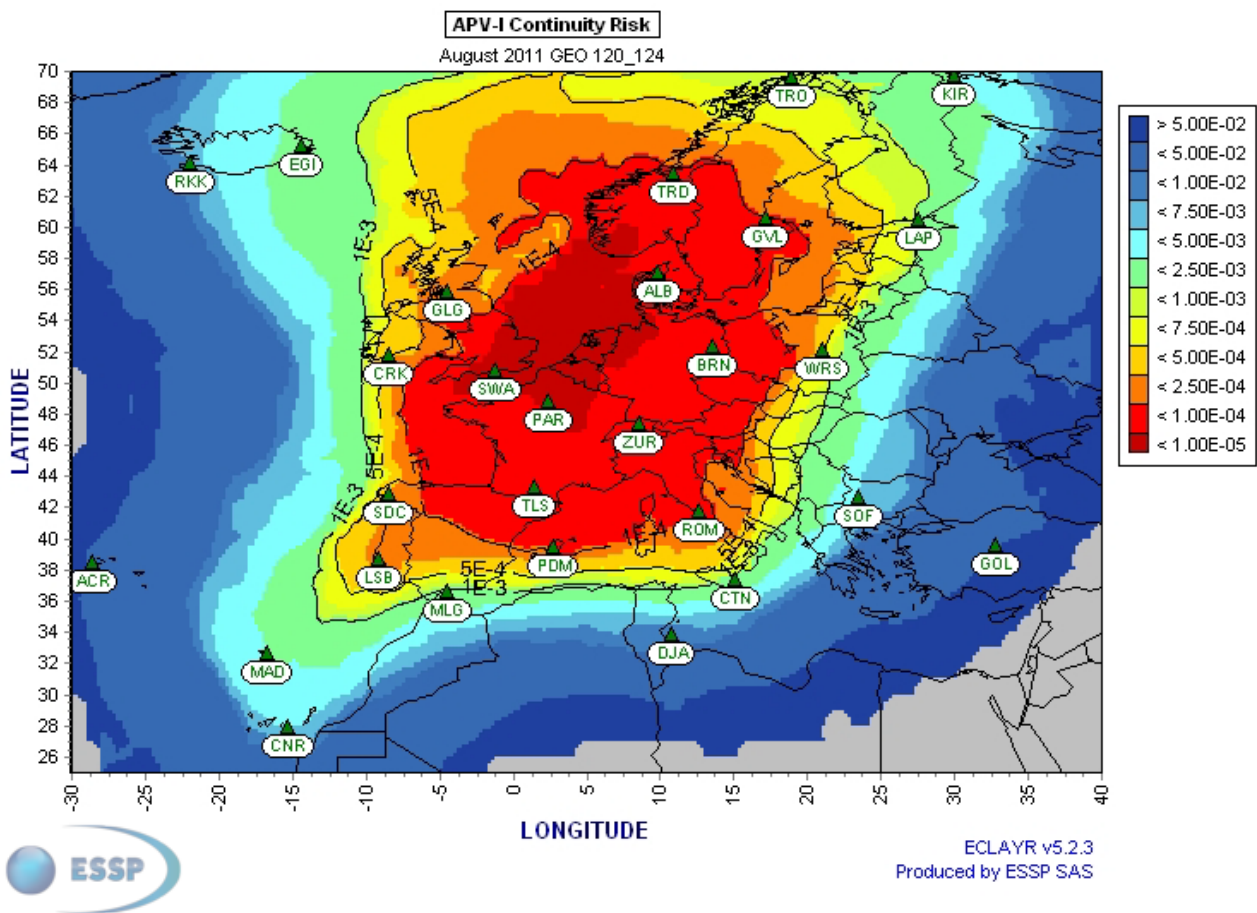


Figure 12 – EGNOS APV-I Continuity

3.2.3 EGNOS APV-I Integrity

EGNOS APV-I Integrity Event is identified in the present report when the Navigation System Error is greater or equal to the corresponding Protection Level for APV-I.

No integrity event was detected.

EGNOS APV-I Integrity is reported as the maximum value of the Safety Index over the month. Safety Index is defined as the relation between Navigation System Error versus Protection Level (assuming PA algorithms to compute $xNSE$ and xPL). In case of ratio xPE/xPL is over 1; it indicates that a Misleading Information situation has occurred.

Next figures provide the histogram for HSI (Horizontal Safety Index) and VSI (Vertical Safety Index) when accumulating measurements from RIMS A sites for the current month. These histograms have considered that Protection Level is below APV-I Alarm Limit.

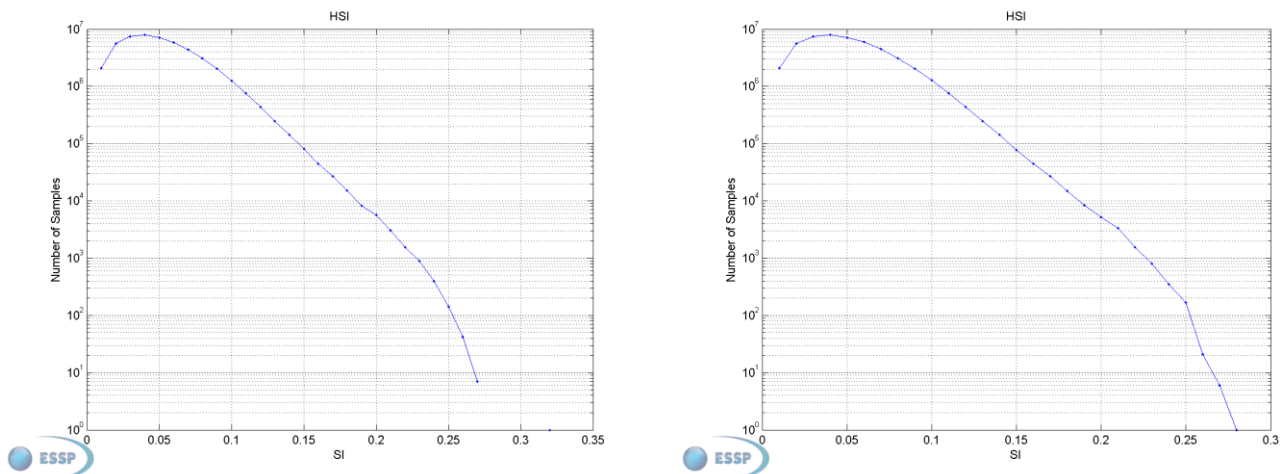


Figure 13 – EGNOS APV-I Horizontal Safety Index of the month: PRN 120 (left) and PRN124 (right)

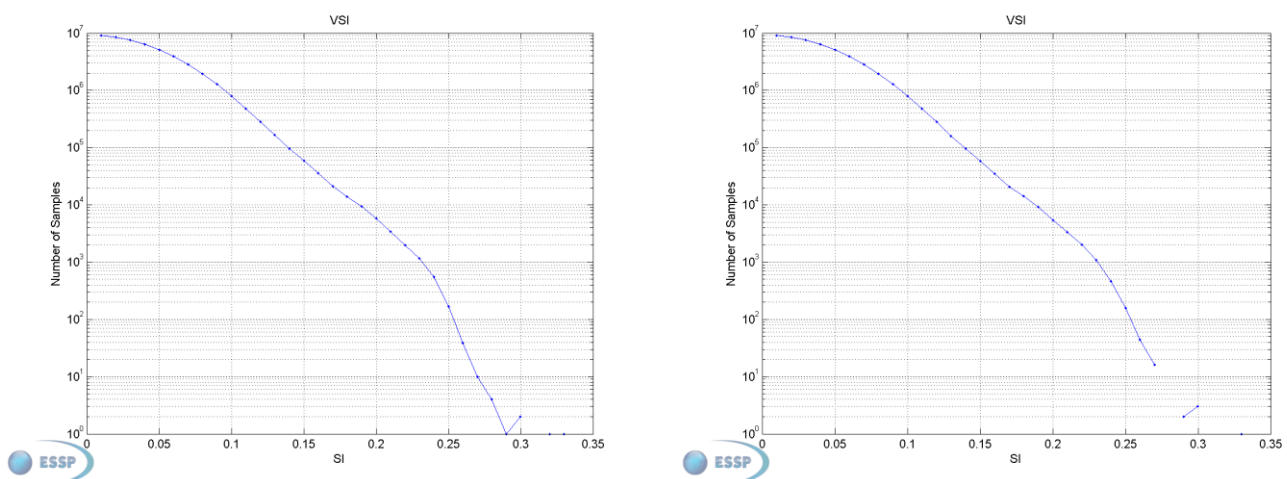


Figure 14 – EGNOS APV-I Vertical Safety Index of the month: PRN 120 (left) and PRN124 (right)



3.2.4 EGNOS APV-I Accuracy

In this report, EGNOS APV-I Accuracy is defined as the monthly average value of 95th percentile of the Horizontal and Vertical Navigation System Error (HNSE and VNSE respectively) over a day, at the monitored sites when applying EGNOS messages. The HNSE and VNSE are measured only when there is a valid APV-I navigation solution.

Following table shows the monthly average of EGNOS APV-I Accuracy values in meters according to the previous definition per operational GEO satellite.

Accuracy [m] (95%) Both GEOs		PRN 120	PRN 124
MLG	HPE	0.99	0.99
	VPE	1.19	1.18
SDC	HPE	1.04	1.04
	VPE	1.19	1.19
PDM	HPE	0.80	0.80
	VPE	1.09	1.09
LSB	HPE	1.06	1.06
	VPE	1.92	1.92
TRD	HPE	0.67	0.67
	VPE	1.35	1.35
CRK	HPE	0.87	0.88
	VPE	1.05	1.05
ZUR	HPE	0.93	0.93
	VPE	0.93	0.93
BRN	HPE	0.81	0.81
	VPE	1.19	1.19
TLS	HPE	0.90	0.90
	VPE	0.94	0.94
TRO	HPE	1.03	1.05
	VPE	2.19	2.22
LAP	HPE	0.86	0.86
	VPE	1.58	1.59
SWA	HPE	1.20	1.21
	VPE	1.46	1.46
ROM	HPE	0.91	0.91
	VPE	1.22	1.23
ALB	HPE	0.61	0.61
	VPE	1.12	1.13
GLG	HPE	0.72	0.72
	VPE	1.09	1.09
KIR	HPE	0.89	0.90
	VPE	1.71	1.71
GVL	HPE	0.61	0.61
	VPE	1.39	1.39
WRS	HPE	0.87	0.86
	VPE	1.18	1.18
CTN	HPE	1.14	1.15
	VPE	1.66	1.66
MAD	HPE	1.05	1.04
	VPE	1.68	1.67
TOR	HPE	0.87	0.87
	VPE	1.10	1.10

Table 5 – Average of EGNOS APV-I Accuracy on PRN 120 and 124 at reference stations



4 EGNOS DATA ACCESS SERVICE (EDAS)

EDAS (EGNOS Data Access Service) offers ground-based access to EGNOS data. It is the single point of access for the data collected and generated by the EGNOS infrastructure composed of ground stations distributed over Europe and North Africa.

The main data provided by EDAS are:

- Raw GPS and EGNOS GEO observations and navigation data collected by the entire network of Ranging and Integrity Monitoring Stations (RIMS) and Navigation Land Earth Stations (NLES).
- EGNOS augmentation messages, as normally received by users via the EGNOS Geostationary satellites.

In addition, EDAS provides the Antenna Phase Centre Coordinates , which is a list of the geographical coordinates of all RIMS stations.

Data are available through two different formats, depending on the type of service selected:

- in Abstract Syntax Notation One (ASN.1), for Service Level 0;
- in RTCM 3.0 (www.rtcn.org), for the Service Level 1.

For further details on the EDAS service, please visit the EDAS website (<http://www.gsa.europa.eu/go/egnos/edas>).

Below, the EDAS availability figure and downtime duration during August 2011, for both service levels (SL0 and SL1) are provided¹.

	SL0	SL1	Global
EDAS Service Operational Availability	>99.99%	>99.99%	>99.99%
EDAS Service Operational Downtime	134 seconds	134 seconds	134 seconds

Table 6 – EDAS Availability

¹ EDAS performances have been monitored during 99.99% of the reported period.



FOR MORE INFORMATION

To get more information about EGNOS performances, please visit the EGNOS user Support web site at

<http://egnos-user-support.essp-sas.eu/>

or

contact the EGNOS helpdesk at

egnos-helpdesk@essp-sas.eu

TO PROVIDE YOUR FEEDBACK

You can provide us with your feedback on the EGNOS SoL use and service provision by filling the following [questionnaire](#).

A button inside allows returning the questionnaire automatically to ESSP.

APPENDIX A REFERENCE DOCUMENTS

[RD 1]	Open Service Definition Document, EGN-SDD-OS; v.01-01 (available in http://www.essp-sas.eu/service_definition_documents)
[RD 2]	Safety Of Life Definition Document , EGN-SDD SoL, v.01-00 (available in http://www.essp-sas.eu/service_definition_documents)
[RD 3]	Service Notice #1 MT9-MT17 status (available at http://www.essp-sas.eu/service_notices)



APPENDIX B LIST OF ACRONYMS

Acronym	Definition
ALB	Alborg
APV	Approach with Vertical Guidance
ASN	Abstract Syntax Notation
BRN	Berlin
CRK	Cork
CTN	Catania
ECAC	European Civil Aviation Conference
EDAS	EGNOS Data Access Service
EGNOS	European Geostationary Navigation Overlay Service
ESSP	European Satellite Services Provider
GEO	Geostationary Satellite
GLG	Glasgow
GNSS	Global Navigation Satellite System
GPS	Global Positioning System
GVL	Gävle
HNSE	Horizontal Navigation System Error
HPE	Horizontal Position Error
HPL	Horizontal Protection Level
LAN	Langen
LSB	Lisbon
MAD	Madeira
MI	Misleading Information
MLG	Málaga
NA	Not Applicable/ Not Available
NANU	Notice Advisory to Navstar Users
NLES	Navigation Land Earth Station
NPA	Non-Precision Approaches
OP	Operation
OPS	Operations
OS	Open Service
PA	Precision Approach
PDM	Palma De Mallorca
PL	Protection Level



ESSP SAS

EGNOS Monthly Performance Report - August 2011

Doc: ESSP-DRD-4898

Issue:01-00

Date: 27.09.2011

Page 22 of 23

PRN	Pseudo-Random Number
RAIM	Receiver Autonomous Integrity Monitoring
RD	Reference Document
RIMS	Ranging and Integrity Monitoring Station
ROM	Roma
RTCM	Radio Technical Commission for Maritime Services
SBAS	Satellite-Based Augmentation System
SCZ	Scanzano
SDC	Santiago De Compostela
SDD	Service Definition Document
SIS	Signal-In-Space
SLO	Service Level 0
SL1	Service Level 1
SWA	Swanwick
TERESA	TEsting Receiver for EGNOS using Software Algorithms
TLS	Toulouse
TOR	Torrejón
TRD	Trondheim
TRO	Tromsø
TWAN	Transport Wide Area Network
UK	United Kingdom
VNSE	Vertical Navigation System Error
VPE	Vertical Position Error
VPL	Vertical Protection Level
WRS	Warsaw
ZUR	Zurich



ESSP SAS

EGNOS Monthly Performance Report - August 2011

Doc: ESSP-DRD-4898

Issue:01-00

Date: 27.09.2011

Page 23 of 23

END OF THE DOCUMENT